


# Effective Impedance Measurement Using OPEN/SHORT/LOAD Correction

Application Note 346-3

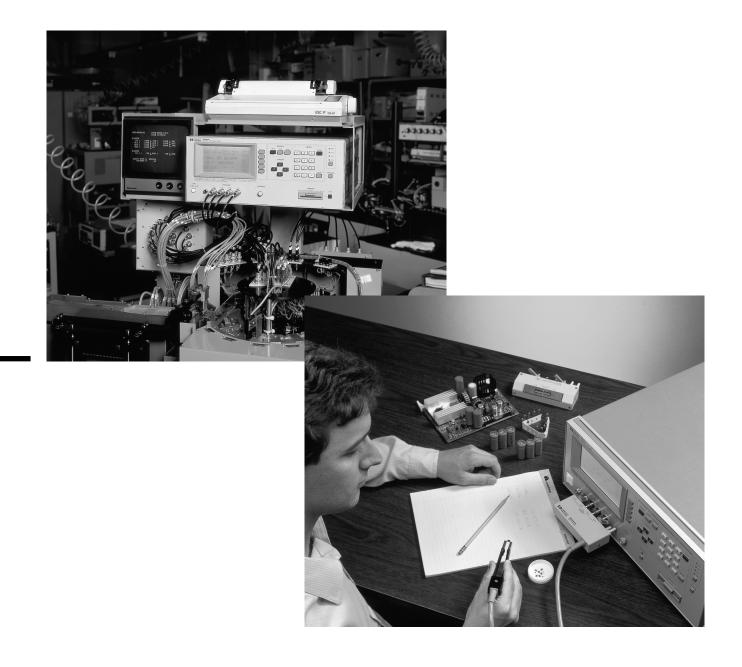

## Introduction


Generally, impedance measurement instruments have a reference plane to define the measurement accuracy at the UNKNOWN terminals of its front panel. HP impedance measurement instruments have a cable length correction function which is applicable for defining the reference plane at the end of the HP test leads. In the actual measurement, a test fixture is connected to the reference plane. Test fixtures degrade the total measurement accuracy by their residual impedance. To improve this degradation, error correction should be applied. The OPEN/SHORT correction is the most popular correction technique used in recent impedance measurement instruments, But when complicated residuals exist (for example, when a scanner or a handler is used), or when using an extension cable whose length cannot be compensated with the cable length correction function, the OPEN/SHORT correction cannot minimize error sufficiently. To minimize these errors, the OPEN/SHORT/LOAD correction is very effective. This application note describes effective impedance measurements using the OPEN/SHORT/LOAD correction.

# How OPEN/SHORT/LOAD correction differs from OPEN/SHORT correction

Here we compare the principle of the OPEN/SHORT/LOAD correction with the OPEN/SHORT correction.

## 1. OPEN/SHORT correction

In the OPEN/SHORT correction, the residuals of a test fixture can be modeled as an equivalent circuit shown in Figure 1.

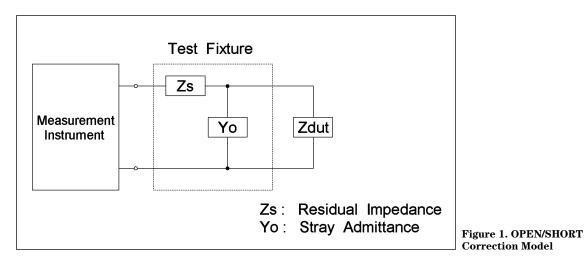

Since Zs <<1/Yo, stray admittance Yo can be measured when the test terminals are open. Similarly residual impedance Zs can be measured when the test terminals are shorted. using this correction data, Device-Under-Test(DUT) measurement data Zm can be compensated with the following equation. Then a true value, Zdut, can be derived from Zm by removing the residuals of a test fixture.

where,

- Zdut: True value of DUT
- Zm: Measurement value of DUT
- Yo: Admittance of OPEN condition
- Zs: Impedance of SHORT condition
  - (Note that each parameter has real and imaginary components.)

As it has been shown, simple measurement errors can be mathematically compensated by using the OPEN/SHORT correction. However, this specific technique is usable only when performing measurements under the following test conditions:

- Using an HP test fixture
- Measurements at the front panel terminals
- Measurements using an HP test cable compensated for electrical length

There are numerous test conditions where complicated impedance parasitic cannot be modeled as the simple equivalent circuit in Figure 1. The OPEN/SHORT correction will not truly compensate for errors introduced in the following test situations:

- Scanner/multiplexer/matrix switches
- Component handlers
- Custom-made test fixture
- Non-standard length cable test leads
- External DC bias circuitry
- Balun transformer
- Additional filters and amplifiers

In addition, the OPEN/SHORT correction has the following severe limitations:

- Not able to correlate measurement values from different test instruments
- Not able to improve measurement repeatability

To solve these test limitations and issues, the OPEN/SHORT/LOAD correction is necessary.

## 2. OPEN/SHORT/LOAD correction

The OPEN/SHORT/LOAD correction requires the measurement data of a standard DUT with known values in addition to the OPEN/SHORT measurement data. The residuals of a test fixture can be defined as a four-terminal network expressed with A, B, C, D parameters as shown in Figure 2.

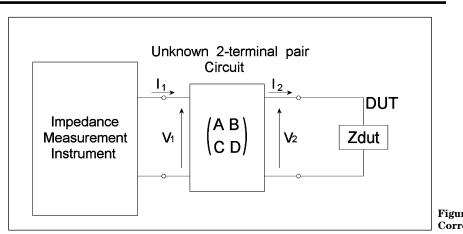


Figure 2. OPEN/SHORT/LOAD Correction Model

With the assumption that a DUT with an impedance of  $Z_2$  is connected to the front panel terminals, the instrument would measure an impedance value of  $Z_1$ . The following relationship defines  $Z_1$ .

Given: $Z_1=V_1/I_1$  and  $Z_2=V_2/I_2$ 

$$z_1 = \frac{AV_2 + BI_2}{CV_2 + DI_2} = \frac{AZ_2 + B}{CZ_2 + D}$$

The parameters of A,B,C and D can be removed when using the following definitions:

- Zo: Measured value when the instrument terminals are open.
- Zs: Measured value when the terminals are shorted.
- Zsm: Measured value of the standard DUT when connected to the test setup.
- Zstd: True (or expected) value of the reference DUT.
- Zxm: Measured value of DUT.
- Zdut: Corrected value of DUT.

All of the analysis yields an equation that corrects for impedance parasitcs:

Zdut= (Zsm-Zs) (Zxm-Zs) (Zsm-Zs) (Zo-Zxm)

(Note that each parameter has real and imaginary components.)

The OPEN/SHORT/LOAD correction function is built into the following HP LCR meters/analyzers:

■ HP 4263B	■ HP 4286A
■ HP 4278A	■ HP 4291B
■ HP 4279A	■ HP 4395A with opt. 010 and HP 43961A
■ HP 4284A	■ HP 4396B with opt. 010 and HP 43961A
■ HP 4285A	-

Otherwise, when using other LCR meters or analyzers, a computer can be programmed to make the OPEN/SHORT/LOAD corrections through HP-IB.

## Consideration with OPEN/SHORT/LOAD correction

When performing OPEN/SHORT/LOAD correction, the following points should be considered.

## **1.OPEN correction**

It is important to measure the stray admittance of a test fixture accurately in the OPEN correction. When getting the OPEN correction data, the distance between measurement terminals should be the same as the distance that is required for actually holding the DUT.

## **2.SHORT correction**

It is important to measure the residual impedance of a test fixture accurately in the SHORT correction. When getting the SHORT correction data, the measurement terminals should be shorted or connected to a shorting device. When using the shorting device, the residual impedance must be much less than impedance value of DUT.

### **3.LOAD** correction

In the LOAD correction, selection and measurement of the standard DUT should be considered carefully.

(1) Selection of standard DUT

When selecting the standard DUT, there is no restriction that inductor must be used for inductance measurement, or capacitor must be used for a capacitance measurement. Any device can be used if its impedance value is accurately known. It is important to use a stable DUT not susceptible to influences of environment such as temperature or magnetic fields. From this viewpoint, capacitors or resistors are better sited than inductors which are more susceptible to the environment.

Especially in the case of measuring low loss (low D, high Q, low ESR) DUTs, it is necessary to use as low loss standard DUT as possible. Since it is difficult to get low loss inductor but easy to get capacitor, low loss capacitors are recommended for the standard DUT.

(2) Impedance value of standard DUT

When measuring a DUT's various impedance values, it is recommended to use a  $100\Omega$  to  $1k\Omega$  device as the standard DUT. It can be measured accurately by impedance measurement instruments and is not susceptible to contact resistance or residuals.

When measuring a DUT of one impedance value, it is recommended that the standard DUT have a impedance value close to that of the DUT. By using a standard DUT, we can reduce the non-linear errors near its impedance value. However, when the DUT's impedance value is very low or very high, it is recommended to use a standard DUT of  $100\Omega$  or  $1k\Omega$ , whose value isn't close to the impedance of the DUT. When a low or high impedance standard DUT is used, the reference value (described later) of the standard DUT cannot be obtained accurately, and it may cause the abnormal measurement results, not the true value

(3) Referencing the standard DUT

of the DUT.

To perform the OPEN/SHORT/LOAD correction, it is necessary to measure the standard DUT for a reference value (known value) beforehand. When measuring it, it is important to use a high accuracy instrument and to set its measurement conditions (such as integration time or averaging time) so that it can measure as accurately as possible. To minimize the measurement error, the standard DUT should be measured using a directconnected test fixture after performing the OPEN/SHORT correction.

# 4. Measurement condition of impedance measurement instruments when performing the OPEN/SHORT/LOAD correction

Impedance measurement equipment with the OPEN/SHORT/LOAD correction function will automatically set the measurement condition (such as integration time or averaging time) so that it can perform error correction with highest accuracy.

If performing the OPEN/SHORT/LOAD correction for instruments not equipped with the OPEN/SHORT/LOAD correction function using an external controller, the measurement conditions should be set to measure correction data as accurately as possible.

# Example of actual OPEN/SHORT/LOAD correction

Figure 3 shows the measurement example to extend the HP 4285A's measurement terminal using 16048E(4m cable). In this case, it is necessary to perform the OPEN/SHORT/LOAD correction since the HP 4285A cannot compensate the 4m extension cable with its cable length correction function. Figure 4 shows the comparison of measurement error between 100pF capacitor measurement with the OPEN/SHORT correction and that with


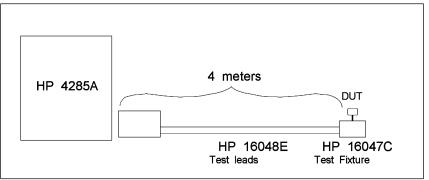


Figure 3. Cable Extension Using an HP 16048E (4m) the OPEN/SHORT/LOAD correction. A 47pF capacitor is used as a standard DUT. This measurement result shows the error cannot be minimized sufficiently with the OPEN/SHORT correction, but can be compensated with an OPEN/SHORT/LOAD correction as shown by the plot.

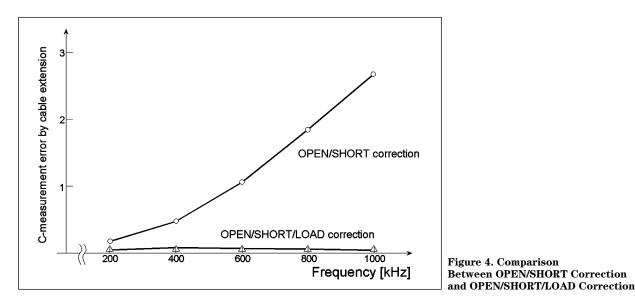

## OPEN/SHORT/LOAD correction with an external controller

The OPEN/SHORT/LOAD correction can be accomplished with simple key operation when using an impedance measurement instruments equipped with the OPEN/SHORT/LOAD correction function. When using instruments not equipped with the OPEN/SHORT/LOAD correction function, it is possible to perform the OPEN/SHORT/LOAD correction by executing the correction calculation with an external controller. But this method has the following tradeoff problems as the comparison with the correction of a measurement instrument alone.

- Complicated operation
- Slow measurement speed due to data transfer time

Figure 5 shows an example program to execute the OPEN/SHORT/LOAD correction for capacitor measurement using the HP 4194A Impedance Analyzer. In this program, the measurement is performed at one frequency point with a manual trigger mode.

Line 130-190	setting measurement condition.	
Line 210-270	Measuring impedance of OPEN condition in G-B mode.	
Line 300-330	Measuring impedance of SHORT condition in R-X mode.	
Line 350-610	Measuring impedance of the standard DUT after inputting	
	Cs-D or Cp-D value of valued standard DUT.	
Line 660-690	selecting DUT mode(Cs-D or Cp-D),	
Line 710-1010	Executing correction calculation after measuring	
	impedance of DUT, then displaying the result.	

# Conclusion

This application note shows the principle of the OPEN/SHORT/LOAD correction and some points to be considered in the execution. With the proper OPEN/SHORT/LOAD correction, measurement comes higher in accuracy.

"Reference" Impedance measurement handbook (5091-3000)

Figure 5. Sample Program for HP 4194A OPEN/SHORT/LOAD Correction

```
10
                                   OPEN/SHORT/LOAD CORRECTION (4194A C-D MEAS)
                      !
 20
30
                     CLEAR SCREEN
  4ŏ
                     OPTION BASE 1
40
50
60
70
80
90
100
                                                                                                                                   ! CORRECTION DATA:Zcor(*)=Rcor(*)+jXcor(*)
! LOAD VALUE:Zstd=Rstd+jXstd
! DUT MEASUREMENT VALUE:Zxm=Rxm+jXxm
! CORRECTED RESULT:Z=R+jX
                     DIM Rcor(3), Xcor(3)
                     COMPLEX Zcor(10), Zstd, Zxm, Z
                     Freq=1.000E+6
                                                                                                                                                                                     ! f=1MHz
  110
                     ASSIGN @Adrs TO 717
  120
130
140
                     REMOTE @Adrs
                                                                                                                                                                                    << 4194A SET UP >>
! IMPEDANCE MEAS MODE
! MANUAL MEAS
                    !
OUTPUT @Adrs;"FNC1"
OUTPUT @Adrs;"SVM3"
OUTPUT @Adrs;"MANUAL=1M"
OUTPUT @Adrs;"TRGM2"
OUTPUT @Adrs;"OPNO"
OUTPUT @Adrs;"SHTO"
  150
 160
170
180
                                                                                                                                                                                          f=1MHz
                                                                                                                                                                                    ! EXT/MAN TRG MODE
! OPEN OFFSET:OFF
! SHORT OFFSET:OFF
 190
200
                                                                                                                                                                                    << OPEN MEASUREMENT >>
! SET 4194A TO G-B
 210
220
230
240
250
260
270
280
290
300
                    .
OUTPUT @Adrs;"IMP9"
PRINT "MEASURE OPEN (TYPE 'CONT')"
                     PAUSE
                     CALL Measure(G,B,@Adrs)
Rcor(2)=G/(G*G+B*B)
Xcor(2)=-B/(G*G+B*B)
                                                                                                                                                                                    ! OPEN MEASUREMENT
! -> Rcor(2),Xcor(2)
                                                                                                                                                                                    << SHORT MEASUREMENT >>
! SET 4194A TO R-X MODE
                    OUTPUT @Adrs;"IMP2"
PRINT "MEASURE SHORT (TYPE 'CONT')"
310
320
330
340
350
360
370
                     PAUSE
                     CALL Measure(Rcor(3), Xcor(3), @Adrs)
                                                                                                                                                                                    ! SHORT MEASUREMENT
                    -> RCOR(3), XCOr(3)
-> RCOR(3), XCOR(3), XCOR(3)
-> RCOR(3), XCOR(3), XCO
                    INPUT "MODE OF LOAD : 1.Cs-
IF Mode=1 THEN
OUTPUT @Adrs;"IMP2"
INPUT "Cs OF LOAD=",Cstd
INPUT "D OF LOAD=",Dstd
Xstd=-1/(2*PI*Freq*Cstd)
Rstd=Xstd*Dstd
DDINT UMEASURE LOAD(TYPE
  380
                                                                                                                                                                                          SET 4194A TO R-X
INPUT LOAD VALUE
390
400
410
420
430
440
450
                                                                                                                                                                                    ! Cs,D -> Rstd,Xstd
                            PRINT "MEASURE LOAD(TYPE 'CONT')"
                            PAUSE
                            CALL Measure(Rcor(1), Xcor(1), @Adrs)
                                                                                                                                                                                    ! LOAD MEASUREMENT
 460
                     END IF
                                                                                                                                                                                              ->Rcor(1),Xcor(1)
470
480
                    IF Mode=2 THEN
OUTPUT @Adrs;"IMP9"
INPUT "Cp OF LOAD=",Cstd
INPUT "D OF LOAD=",Dstd
Bstd=2*PI*Freq*Cstd
Gstd=-Ostd*Bstd
Patd=Cstd(Cstd#Cstd+Dstr
490
500
510
                                                                                                                                                                                    ! SET 4194A TO G-B
! INPUT LOAD VALUE
520
                                                                                                                                                                                    ! Cp,D -> Rstd,Xstd
530
540
550
                           Rstd=Gstd/(Gstd*Gstd+Bstd*Bstd)
Xstd=-Bstd/(Gstd*Gstd+Bstd*Bstd)
PRINT "MEASURE LOAD(TYPE 'CONT')"
 560
570
580
590
                            PAUSE
                           CALL Measure(G,B,@Adrs)
Rcor(1)=G/(G*G+B*B)
Xcor(1)=-B/(G*G+B*B)
                                                                                                                                                                                    ! LOAD MEASUREMENT
                                                                                                                                                                                    ! -> Rcor(1),Xcor(1)
600
610
                    END IF
620
630
640
                    MAT Zcor= CMPLX(Rcor,Xcor)
Zstd=CMPLX(Rstd,Xstd)
                                                                                                                                                                                    ! Zcor(*)=Rcor(*)+jXcor(*)
                                                                                                                                                                                   ! Zstd=Rstd+jXstd
650
660
670
                                                                                                                                                                                    << SELECT DUT MODE >>
                   INPUT "MODE OF DUT : 1.Cs-D 2.Cp-D",Dmode
IF Dmode=1 THEN OUTPUT @Adrs;"IMP2"
IF Dmode=2 THEN OUTPUT @Adrs;"IMP9"
PRINT "MEASURE DUT(TYPE CONT!)"
PAUSE
680
                                                                                                                                                                                   .
! Cs-D -> SET 4194A TO R-X
! Cp-D -> SET 4194A TO G-B
690
700
710
720
730
740
750
760
770
                                                                                                                                                                                    << DUT MEASUREMENT >>
                    WHILE P<>0
                                                                                                                                                                                   !
                          CALL Measure(Gxm,Bxm,@Adrs)
IF Dmode=1 THEN
                                                                                                                                                                                   I Cs-D
                                 Rxm=Gxm
780
790
                                 Xxm=Bxm
                                                                                                                                                                                    ļ
                          END IF
IF Dmode=2 THEN
800
                                                                                                                                                                                   ! Cp-D
```

810       Rxm=Gxm/(Gxm*Gxm+Bxm*Bxm)       !         820       Xxm=-Bxm/(Gxm*Gxm+Bxm*Bxm)       !         830       END IF       !         840       Zxm=CMPLX(Rxm,Xxm)       !       Zxm=Rxm+jXxm         850       Z=FKCalcurate(Zcor(*),Zstd,Zxm)       !       CALCURATION         850       Z=FKCalcurate(Zcor(*),Zstd,Zxm)       !       CALCURATION         860       R=REAL(Z)       !       Z=+;jX         870       X=!MAG(Z)       !       R,X -> Cs,D         880       IF Dmode=1 THEN       !       .         900       Cs=-1/(2*P1*Freq*X)       !       R,X -> Cp,D         910       PRINT "Cs,D=",Cs,D       !       .         920       IF Dmode=2 THEN       !       R,X -> Cp,D         930       IF Dmode=2 THEN       !       .         940       D=R/X       !       R,X -> Cp,D         950       BX/(R*R+X*X)       !       .         960       LPB/INT "Cp,D=",Cp,D       !       .         970       PRINT "Cp,D=",Cp,D       !       .         980       END IF       !       .       .         970       PRINT "Cp,D=",Cp,D       !       !       .<	TAT BYTE
---	----------

Appendix. Correction Capability of HP Instruments

Model No.	Correction Capability	Cable Length Correction
HP 4192A	OPEN/SHORT Correction	0m/1m
HP 4194A	OPEN/SHORT Correction	0m/1m
HP 4195A(*) with HP 41951A	OPEN/SHORT Correction	none (Electrical Length Correction)
HP 4263A(*)	OPEN/SHORT Correction OPEN/SHORT/LOAD Correction (via HP-IB)	0m/lm/2m
HP 4263B	OPEN/SHORT/LOAD Correction	0m/1m/2m/4m
HP 4274A(*) /HP 4275A(*)	OPEN/SHORT Correction	0m /lm
HP 4276A(*) /HP 4277A(*)	OPEN/SHORT Correction	0m/1m
HP 4278A	OPEN/SHORT/LOAD Correction Multi Channel Correction (Opt.301)	0m/1m/2m
HP 4279A	OPEN/SHORT/LOAD Correction Multi Channel Correction	0m/1m/2m
HP 4284A	OPEN/SHORT/LOAD Correction Multi Channel Correction (Opt.301)	0m/1m 0m/1m/2m/4m (Opt.006)
HP 4285A	OPEN/SHORT/LOAD Correction Multi Channel Correction (Opt.301)	0m/1m/2m
HP 4286A	OPEN/SHORT/LOAD Correction	none (Electrical Length Correction)
HP 4291A(*)	OPEN/SHORT/LOAD Correction	none (Electrical Length Correction)
HP 4291B	OPEN/SHORT/LOAD Correction	none (Electrical Length Correction)
HP 4395A with Opt.010,43961A	OPEN/SHORT/LOAD Correction	none (Electrical Length Correction)
HP 4396B with Opt.010,43961A	OPEN/SHORT/LOAD Correction	none (Electrical Length Correction)

(\*) Obsolete



For more information about Hewlett-Packard test & measurement products, applications, services, and for a current sales office listing, visit our web site, http://www.hp.com/go/tmdir. You can also contact one of the following centers and ask for a test and measurement sales representative.

#### **United States:**

Hewlett-Packard Company Test and Measurement Call Center P.O. Box 4026 Englewood, CO 80155-4026 1 800 452 4844

#### Canada:

Hewlett-Packard Canada Ltd. 5150 Spectrum Way Mississauga, Ontario L4W 5G1 (905) 206 4725

### Europe:

Hewlett-Packard European Marketing Centre P.O. Box 999 1180 AZ Amstelveen The Netherlands (31 20) 547 9900

#### Japan:

Hewlett-Packard Japan Ltd. Measurement Assistance Center 9-1, Takakura-Cho, Hachioji-Shi, Tokyo 192-8510, Japan Tel: (81) 426 56 7832 Fax: (81) 426 56 7840

#### Latin America:

Hewlett-Packard Latin American Region Headquarters 5200 Blue Lagoon Drive 9th Floor Miami, Florida 33126 U.S.A. Tel: (305) 267-4245 (305) 267-4220 Fax: (305) 267-4288

Australia/New Zealand: Hewlett-Packard Australia Ltd. 31-41 Joseph Street Blackburn, Victoria 3130 Australia

Tel: 1800 629 485 (Australia) 0800 738 378 (New Zealand) Fax: (61 3) 9210 5489

#### Asia Pacific:

Hewlett-Packard Asia Pacific Ltd. 17-21/F Shell Tower, Times Square, 1 Matheson Street, Causeway Bay, Hong Kong Tel: (852) 2599 7777 Fax: (852) 2506 9285

Data subject to change Copyright © 1998 Hewlett-Packard Company Printed in U.S.A. 6/98 5091-6553E