



Ampex

Customer Service Bulletin

SLM Electronics, Inc. Saint Louis, Missouri

August 17, 1999

CSB0014

Units Affected:

<u>Model</u>	<u>Serial Number</u>
SVT-2PRO	ATLJL10001 through ATLJL10030 ATLWL40001 through ATLWL40010
SVT-CL	TCLWL10001 through TCLWL10025

Purpose:

Some units may fail to work when the power tube socket(s) solder joints fracture due to mechanical stress.

Corrective Action:

NOTE: Use standard anti-static precautions when working with the PCB.

1. Unplug the unit.
2. Disassemble the unit and remove the power tube PCB (SLME #07-419-41).
3. Inspect all solder joints on the tube sockets. Minimally resolder the power tube socket joints.
4. Reinstall the power tube PCB and reassemble the entire unit.

SLM Electronics, A Division of St. Louis Music, Inc.
11880 Borman Drive, St. Louis, MO 63146
Phone (314) 569-0141
Service Department: Phone (800) 738-7563; Fax (314) 567-7278