

TECHNICAL INFORMATION



No: 76/02/03/NAS
Ref:
Issue: 1
Date: 02/28/03

Cargo Blind Snap Replacement

AFFECTED VEHICLE RANGE:

Discovery Series II (LT)

All

SITUATION:

LOAD SPACE ROLLER BLIND SNAP BROKEN

The snap that secures the load space roller blind to the rear seat may break under excessive force.

RESOLUTION:

ALIGN AND INSTALL NEW STUD

Where a complaint of a failed roller blind snap is confirmed, replace the snap with a new snap with components now available from Land Rover Parts.

PARTS INFORMATION:

VUB000640Press stud repair kit

WARRANTY CLAIMS:

76.67.02Time 0.10 hrs.

Install replacement cargo blind snap

FAULT CODE: D


Normal warranty policy and procedures apply.


Material allowance is included in labor operation.

REPAIR PROCEDURE

SNAP REPLACEMENT

1. Release and remove the load space roller blind from the vehicle.
2. Position the load space roller blind on a clean flat bench and remove the broken "female" snap.
3. Refer to Figure 1 and from the underside of the load space roller blind, locate the stemmed snap head (D), through the roller blind fabric (C).
4. Position the die (E) under the stemmed button.
5. From the top of the load space roller blind, locate the female snap (B) over the stemmed button.
6. From the top of the load space roller blind, position the punch (A) to the top of the stemmed button.
7. Strike the punch firmly with a hammer.
8. Remove the die (E) from the stemmed snap head.
9. Fit the load space roller blind and secure in retainers.
10. Secure load space roller blind to the rear seat using the snap.

 **NOTE: If the press stud rotates in the fabric repeat step 5 until the press stud is secure.**

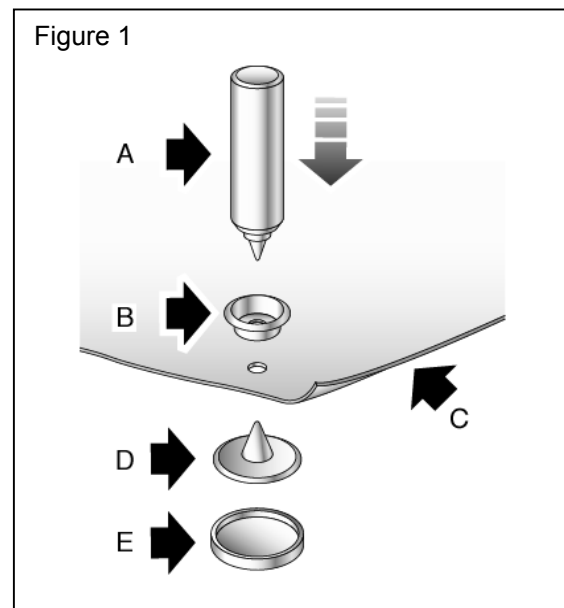

TIB	CIRCULATE:	Service Mgr	Warranty	Workshop	Body Shop	Parts
76/02/03/NAS	TO	X	X	X	X	X