

TECHNICAL INFORMATION



No: 76/18/99/NAS
Ref:
Issue: 1
Date: 06/18/99

Rattle In Center Console

AFFECTED VEHICLE RANGE:

Discovery Series II (LT)

Up to XA216045

SITUATION:

EXCESSIVE MOVEMENT AND RATTLES IN THE CENTER CONSOLE

The customer may complain of rattling or knocking noises as a result of side to side movement of the center console. Free-play in the securing cage nuts, may be the cause of up to 4mm of console travel.

RESOLUTION:

REPLACE CAGE NUTS

To resolve a customer complaint of center console rattle as described above, remove the original console securing bolt cage nuts. Install new nuts NK106061L.

PARTS INFORMATION:

NK106061LCage Nuts Qty. 4

WARRANTY CLAIMS:

76.25.01 Time 0.80 hrs.
Replace cage nuts with new specification nuts


FAULT CODE: G

Normal warranty policy and procedures apply

REPAIR PROCEDURE:

1. Refer to WSM 76.25.01 and remove center console.
2. Replace each cage nut as follows:
 - Compress side retainer clips of original cage nut. (Figure 1)
 - Remove and discard cage nut.
 - Install new cage nut (NK106061L) into bracket opening.
3. When all four cage nuts are replaced, refer to WSM 76.25.01 and install center console.

Figure 1

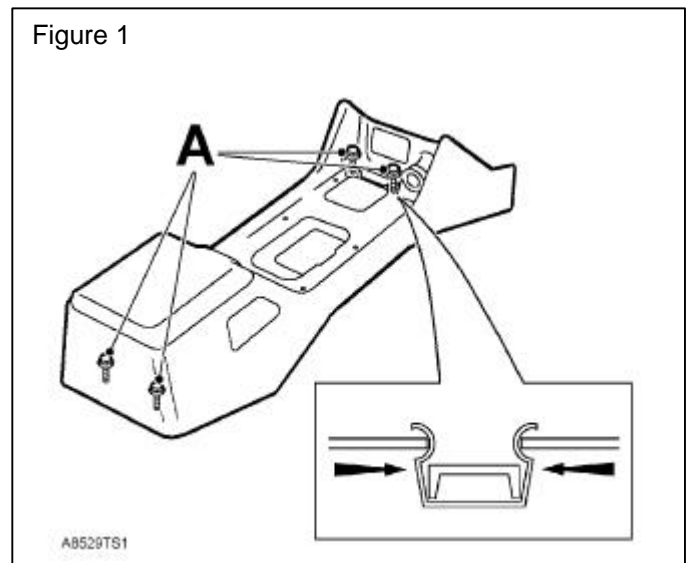

TIB 76/18/99/NAS	CIRCULATE: TO	Service Mgr X	Warranty X	Workshop X	Body Shop X	Parts X
---------------------	------------------	------------------	---------------	---------------	----------------	------------