

TECHNICAL INFORMATION



Right 'A' Pillar Wind Noise Correction

No: 76/11/03/NAS
Ref:
Issue: 1
Date: 04/25/03

AFFECTED VEHICLE RANGE:

Discovery Series II (LT)

3A802000 to 3A810000

SITUATION:

'A' PILLAR WIND NOISE

The customer may complain of a wind noise at speeds above 32 km/h (20 mph) coming from around the top of the right-hand 'A' pillar. A gap in the body sealant on the right hand drip rail is the probably cause.

RESOLUTION:

APPLY SEALANT TO AFFECTED AREA

When the customer complaint is confirmed, application of a sealant to the affected area will fill the gaps and remove the cause of the wind noise.

PARTS INFORMATION:

Locally sourced

- Clear RTV silicone sealant (Permatex 66BR or equivalent)

WARRANTY CLAIMS:

77.90.89/35 Time 0.10 hrs.

Apply sealant to source of noise

FAULT CODE: C


Normal warranty policy and procedures apply.

Material allowance is included in labor operation.

REPAIR PROCEDURE

APPLY SEALANT TO AFFECTED AREA

1. Clean around the area to be sealed on right hand drip rail (Inset 'A' Figure 1).
2. Apply sealant to fill the gap in the body sealant (Inset 'B' Figure 1).
3. Remove any excess sealant.

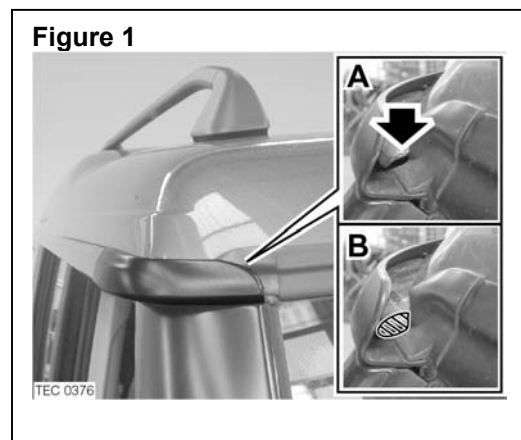

TIB	CIRCULATE:	Service Mgr	Warranty	Workshop	Body Shop	Parts
76/11/03/NAS	TO	X	X	X	X	X