



TECHNICAL ALERT

April 23, 2003

TA03 4401

NAS US Only Cda Only

ATTENTION: Service Manager Service Advisor Technician

Discovery Series II: Correct Installation of AT Selector Knob

SITUATION:

When fitting the automatic transmission selector knob after a service repair, the park release button rod can be damaged. The damage can result from incorrectly positioning the gear selector when the selector knob is fitted. (Figure 1)

RESOLUTION:

When fitting the automatic transmission selector knob, the selector **MUST** be in the PARK (P) position (Figure 2) to ensure that:

- The latching rod is not damaged
- The latching rod does not cause damage to the raised segments of the selector detents.

Figure 1

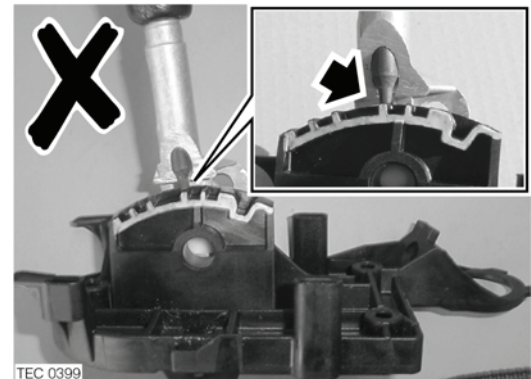


Illustration shows the **incorrect** position of the gearbox selector when fitting the gear knob.

Figure 2

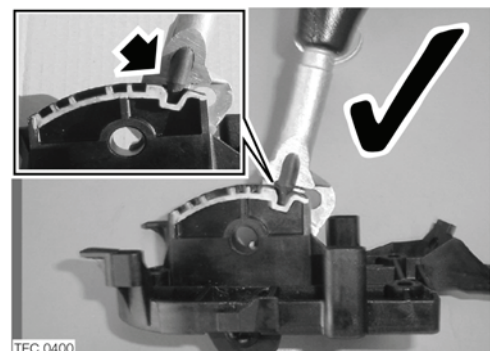


Illustration shows the **correct** position of the gearbox selector when fitting the gear knob.